


AXS Card

SunSpec Modbus Interface

Installation Instructions

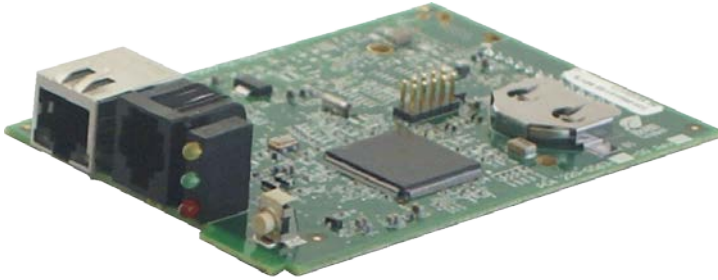

CAUTION: Equipment Damage

Observe precautions for handling electrostatic sensitive devices.




1. Remove all sources of power from the FLEXmax Extreme. Wait 5 minutes.


2. Remove the wiring compartment cover.



3. Remove the blank AXS Card cover.

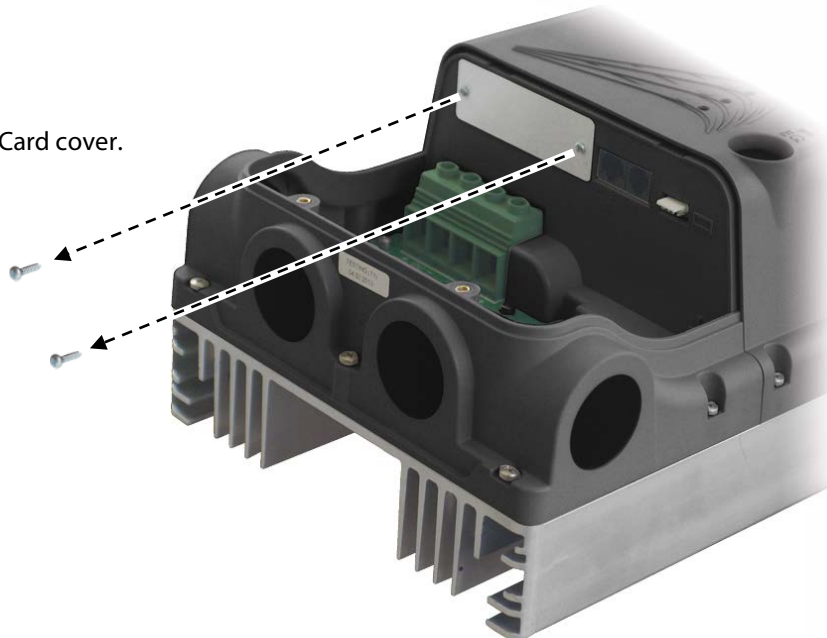

AXS Card Installation Instructions

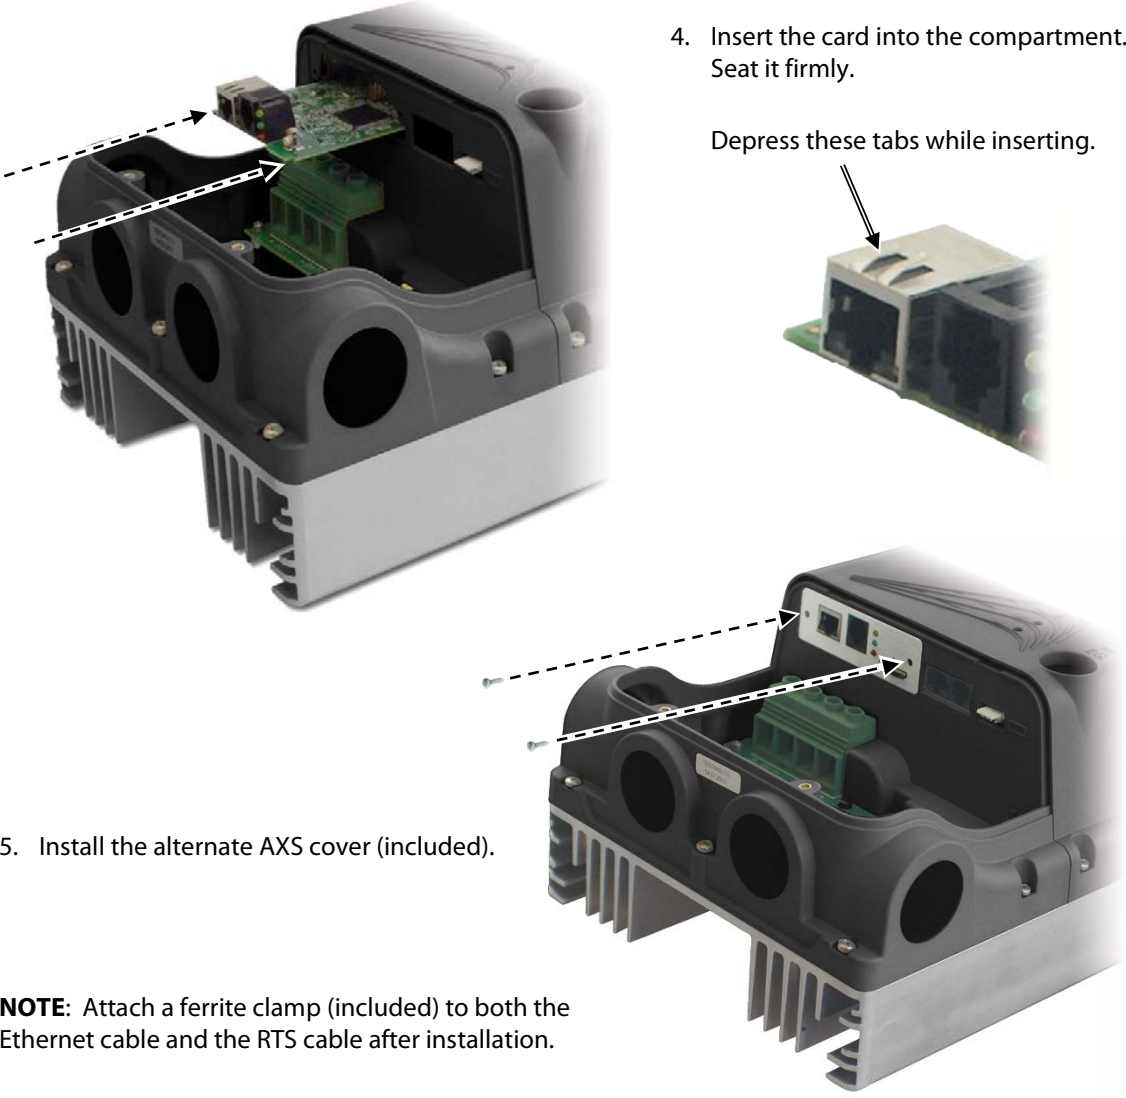

4. Insert the card into the compartment. Seat it firmly.

Depress these tabs while inserting.

5. Install the alternate AXS cover (included).

NOTE: Attach a ferrite clamp (included) to both the Ethernet cable and the RTS cable after installation.

Installation is complete. See the *AXS Port SunSpec Modbus Interface Owner's Manual* for use.

Contact Information

Address: Corporate Headquarters
17825 – 59th Avenue N.E.
Suite B
Arlington, WA 98223 USA

Telephone: +1.360.435.6030
+1.360.618.4363 (Technical Support)
+1.360.435.6019 (Fax)

Email: Support@outbackpower.com

Website: <http://www.outbackpower.com>

European Office
Hansastraße 8
D-91126
Schwabach, Germany

+49.9122.79889.0
+49.9122.79889.21 (Fax)

Part Number, Date and Revision

900-0149-01-00, August 2013, Revision A